


FIRMWARE UPDATE

Firmware update procedure

1. Download the latest Firmware file from your local Alpine homepage.
2. Check the support area. For latest software.
3. Extract the firmware file.
4. Disconnect the power connector.
5. Connect the DSP-E802DSP to your computer (with supplied micro USB cable).
6. The amp will be recognized as disk drive.
7. Delete the old file. The firmware file has always the same name 'software.apn'. No version number is shown.

8. Drag and drop the new Firmware file to the ALPINE AMP folder.

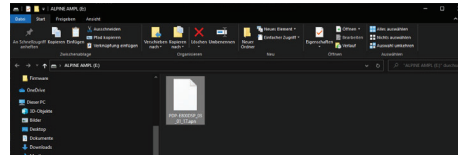

9. Reconnect power.
10. With the next amp start the new firmware will be loaded. It will automatically be renamed to „software.apn“.

